

FIG 5. isolates the dimension that depicts the included angle of the tool tip when a ball nose cutter is used.

20

FIG 6. shows a full isometric 3D view of the multiple axis head and further points out another key dimension used in the calculation.

25

FIG 7. is an isometric view of a CNC machine tool using a multi-axes cutting tool mounted in a tool holder cutting a conceptual part.

FIG 8. is a side view of a CNC machine tool using a multi-axes cutting tool mounted in a tool holder cutting a conceptual part.

30

FIG 9. is a multi-axes G Code program, commonly used in CNC machining, listing the non-compensated axis positions as X,Y,Z,A,B coordinates. These coordinates are read into the system to provide a list of positions to drive the tool to and a tool number listed as "T" to provide a means to look up the user-inserted desired tool size values, as shown in FIG 1., to be used in calculating the compensation amounts.

35 Please delete paragraphs 001, 002, 0021, 0022 and all EXAMPLES beginning at page 6 and ending on page 7, in section entitled "DETAILED DESCRIPTION OF THE INVENTION."

Please replace the entire content of the section entitled "DETAILED DESCRIPTION OF THE INVENTION" beginning on page 4, with the following rewritten content, lines 3-306:

FIG 1. illustrates an operator screen where the machine operator enters the Multi-Axes Tool Compensation values. The user first starts out by entering the tool size as shown on FIG 1. in the box labeled "Size". This describes the tool diameter that will be used by the internal algorithm to compensate or adjust for this size tool when cutting a part on a multi-axes machine. On FIG 1. the box labeled "Horz" is used by the machine operator to enter the horizontal offset value that will be used to compensate for the tool location horizontally. On FIG 1. the box labeled "Vert" is used by the machine operator

10 to enter the vertical offset value that will be used to compensate for the tool location  
vertically. On FIG 1. the box labeled "Height" is used by the machine operator to enter  
the height offset value that will be used to compensate for the tool location in regards to  
the tallest or length of the tool. On FIG 1. the box labeled "Wear" describes the wear  
amount to be deducted from the tool diameter when the tool begins to wear out so that the  
15 true tool diameter can always be compensated. On FIG 1. the boxes labeled "Custom1  
and Custom2" are reserved for future user-defined values. On FIG 1. the box labeled  
"Corner radius" is used to enter a value by the machine operator that would be used by  
the internal algorithm to compensate or adjust for the radius on the end of the tool as  
shown in FIG 2. item (1). On FIG 1. the box labeled "Bottom angle" is used to enter a  
20 value by the machine operator that would be used by the internal algorithm to  
compensate or adjust for the angle on the bottom of the tool as shown in FIG 5. Dim "E"  
item (7). On FIG 1. the box labeled "Side angle" is used to enter a value by the machine  
operator that would be used by the internal algorithm to compensate or adjust for the side  
angle on the side of the tool. On FIG 1. the box labeled "Length" is used to enter a value  
25 by the machine operator that would be used by the internal algorithm to compensate or  
adjust for the actual length of the tool itself as shown in FIG 2. Dim "C" item (4). On  
FIG 1. the box labeled "Type" is the type or kind of tool style. The values to be entered  
vary from machine type to machine type and actually only provide a reference number to  
the machine operator as to which type of tools he uses for that particular machine type.

30 For instance:

Type	0=Flat Ended Mill
	1=Drill Mill or Lathe
35	2=Diamond Insert Lathe
	3=Ball Nose Mill
	4=Custom
	5=Circle Insert Lathe
	6=Triangle Insert Lathe
40	7=Groove or Part Off Tool Lathe

Whereas to further describe the values to enter on FIG 1.:

Corner radius: Is the corner radius of the tool 1/2=ball nose, <= Bull nose cutter.

45 Bottom angle: Is the angle measured from the center tip out. Typically 28 for a drill.

Side angle: Is the angle measured on the cutter's side, like a draft angle or taper.  
Length: The overall tool length.

- 50 Corner radius same as Param1  
Bottom angle same as Param2  
Side angle same as Param3  
Length same as Param4

- 2=Diamond Insert Lathe  
55 Param1 = Nose radius (Default=.03)  
Param2 = Included angle of insert (Default=80)  
Param3 = Mounting angle (Default=45)  
Param4 = Length (Default will size to part)

- C2 60 5=Circle Insert Lathe  
Param1 = Circle radius (Default=.03)  
Param2 = Not used  
Param3 = Not used  
Param4 = Not used

- 65 6=Triangle Insert Lathe  
Param1 = Nose radius (Default=.03)  
Param2 = Mounting angle (Default=0)  
Param3 = Not used  
70 Param4 = Insert size (Default will size to part)

- 7=Groove or Part Off Tool Lathe  
Param1 = Corner nose radius (Default=.03)  
Param2 = Width (Default=.06)  
75 Param3 = Not used  
Param4 = Length (Default=2)

For a Lathe the settings mean:

- 80 SIZE: Tool nose radius  
HORZ: The amount and direction of the Z offset from the tool radius center to the cutting edge.  
VERT: The amount and direction of the X offset from the tool radius center to the cutting edge.  
85 HEIGHT: Not Used  
WEAR: The amount to add or subtract from the Tool Nose Radius caused by tool wear.

For non-lathe 3 or more axis single head or spindled machines the settings mean:

90

SIZE: Tool Diameter

HORZ: Not used

VERT: Not used

HEIGHT: Tool length offset. The amount and direction to offset the Z axis.

95

WEAR: The amount to add or subtract from the tool diameter caused by tool wear.

For a non-lathe 2 axis machine the settings mean (Waterjet, Laser, Plasma, EDM):

100

SIZE: Kerf or Tool Diameter.

HORZ: Not used

VERT: Not used

HEIGHT: Not used

WEAR: The amount to add or subtract from the tool diameter caused by tool wear.

105

For a non-lathe Multi-head or spindled machine.

SIZE: Tool Diameter.

HORZ: The amount or distance and direction of offset on each head in the X axis from the main head.

110

VERT: The amount or distance and direction of offset on each head in the Y axis from the main head.

HEIGHT: Tool length offset. The amount and direction to offset the Z axis.

WEAR: The amount to add or subtract from the tool diameter caused by tool wear.

115

On FIG 1. the group of boxes under the section MACHINE OFFSETS is described as follows:

120

Whenever you zero out the machine's home position, these are the values the machine thinks it is at. Generally, you would home the machine at zero for all axes. Ignore the values for axes you do not have.

The values entered on FIG 1. are stored in the memory of the CNC Controller to be used in the calculations as variables.

125

On FIG 1. the group of boxes under the section FIXTURE OFFSETS is described as follows:

These are values for all 6 axes. Ignore the values for axes you do not have. These  
130 OFFSETs are only added when an OFFSET logic command is issued generally with G54  
through G59 codes. The offset values entered for each axis will be added to the current  
position of the tool together with all other invoked offsets. These are typical G codes, as  
known by industry standards, which refer to machine offsets.

135 On FIG 1. the group of boxes under the section OPTIONAL SETTINGS is  
described as follows:

This is an array of miscellaneous settings that do not directly relate to features  
needed for multiple-axes tool comp. They are presented here to fully disclose how  
multiple-axes tool comp interacts with the various other operator settings and choices.

140  
CJ DRY RUN is used to switch on or off a mode in which the Z axis, Spindle and Feed  
mode will be disabled or not. Commonly used in test runs.

145 BITMAP,G CODE DISPLAY will refresh the GCODE window whenever another  
window pops up over it.

150 GRAPHICS: SOLID VS WIREFRAME switches the graphics display to either a solid  
model or wireframe.

TOLERANCE a user-provided value in which to perform the calculations.

155 BLOCK SKIP CHARACTER is a user-defined character to tell the computer to skip this  
line of data or not.

TEACH FILE NAME is a file name in which to store all of the locations used.

160 SOLID STOCK Begin Z @ specifies the Z axis beginning of the solid model. Typically  
0.

SOLID STOCK Extra Stock adds extra material or stock around the edges or diameter.

165 FANUC ARC CENTER to be calculated from Absolute, incremental or radii given arc  
centers.

The following paragraph is a description of the internal command set and math used internally to calculate the Multi-axes Tool Compensation algorithm. These internal commands are listed below and shown by example:

170  
175  
180

TOOLCOMP OFF	'Turns all compensation off.
TOOLCOMP LEFT	'Comps tool in 2D to the left.
TOOLCOMP RIGHT	'Comps tool in 2D to the right.
TOOLCOMP 3DCOMP	'3D comp based on vector and gouge parameter.
TOOLCOMP 3DADJUSTZ	'3D comp lifts Z axis only but keeps X,Y.
TOOLCOMP 3DOFFSET	'3D parallel offset only - based on vector and no gouge parameter.
TOOLCOMP 5AXIS	'5-axis comp based on vector and gouge parameter.
TOOLCOMP LLIMIT45	'Give angle which will specify a gouge to omit tool position.

C2  
185 The TOOLCOMP command enables 3D and 5-axis tool compensation and has eight possible parameters: OFF, LEFT, RIGHT, 3DCOMP, 3DADJUSTZ, 3DOFFSET, 5AXIS and LLIMIT45. The compensation value is taken from the tool parameter screen for that specific tool number.

190 The tool compensation is processed by the internal Multi-axes Tool Compensation algorithm when a file containing all of the locations are listed that correspond to a tool path along the original non-compensated part to cut. The positions of the original non-compensated tool path are loaded into memory.

195 If the tool size, height, wear, horizontal, vertical, corner radius, bottom angle, side angle, length or type is changed in the boxes depicted in FIG 1. labeled by the same names or the user edits the positions in the file or A.K.A. the G code program to reflect a change in tool comp methods, then the program will automatically reprocess new re-calculated compensated tool position.

200 A database is kept in the machine's memory of these positions plus ever changing conditions that it remembers by learning from what the machine can and cannot do. We

regard this as an artificial intelligence algorithm element, which dynamically changes in real time.

205 If 3D or 5-axis tool comp is used, the file will need to include special codes on each line that will need to be compensated. The special codes are entered using the letters U,V,W or alternately A,B,C depending on the user's choice. The values following U,V,W or A,B,C represent a normalized 3D vectorized value. Vectors are common mathematical properties representing a 3D magnitude of direction pointing in 3D space.

210 The use, knowledge and values of vectors have been used and documented for hundreds of years and are regarded as common knowledge in the mathematical field. The vector used is derived from the direction the original tool was at off the original part surface at any given point in space.

C2

215 The values entered in by command are stored in the memory of the CNC Controller to be used in the calculations as variables.

Shown below are the variables used and how the calculations are made in the central set of math routine algorithms.

220

U,V,W are the end result of the compensated tool positions.

D= the distance or combined length of FIG 2. Dim "A" Item 2, Dim "B" Item 3 and Dim "C" Item 4.

V<sub>x</sub>,V<sub>y</sub>,V<sub>z</sub> are the 3D vector component values.

225 X,Y,Z is the original non-compensated tool position

$$U = D * V_x + X$$

$$V = D * V_y + Y$$

$$W = D * V_z + Z$$

230

The use of the L code represents a conical angle measured from the tool tip point to the nearest obstacle from a flat 2D plane. If the user specifies an angle after LLIMIT, then the tool position move may be completely omitted by the machine if an obstacle is

235 encountered on the part surface in order to automatically avoid gouging as part of the central set of math routine algorithms.

L!= the value given after the LLIMIT command.


240  $L = (D / \sin(L!))$

If  $L < 0$  Then skip this move.

245 Else, combine this value with the D distance value to arrive at a new distance to compensate.

$D=D+L$

250 This occurs if on FIG 5. Dim "E" Item 7, which shows the included angle between the vector and the L code, is less than the value specified after LLIMIT. To turn gouge protection off, specify a zero value after LLIMIT 0.

 255 The following mathematical algorithms are based on three values hard coded into the routine. The user does not have a box to enter these values. Each machine style and head design dynamics determine the following three values used in the compensation algorithm.

260 FIG 3. Item 5 depicts the key pivot point used in the algorithm. The resultant calculation affects the end position by further tilting the U,V,W in the view depicted in FIG 3. Item 5.

265 FIG 4. Dim "D" Item 6 depicts the key angular displacement used in the algorithm. The resultant calculation affects the end position by further tilting the U,V,W in the view depicted in FIG 4. Dim "D" Item 6.

270 FIG 6. Dim "R" Item 8 depicts the key rotational displacement used in the algorithm. The resultant calculation affects the end position by further rotating the U,V,W in the view depicted in FIG 4. Dim "D" Item 6.



As such this set of central math routine algorithms using variables to show the math matrix calculation is shown below:

275 Cz = Cos(Rz): Sz = Sin(Rz): Cx = Cos(Rx): Sx = Sin(Rx): Cy = Cos(Ry): Sy = Sin(Ry)  
 'Z rotate, counter clockwise  
 X1 = U \* Cz + V \* Sz: Y1 = U \* -Sz + V \* Cz: Z1 = W  
 'Y rotate, back  
 X2 = X1: Y2 = Y1 \* Cx + Z1 \* -Sx: Z2 = Y1 \* Sx + Z1 \* Cx  
 280 'X rotate, left  
 U = X2 \* Cy + Z2 \* -Sy: V = Y2: W = X2 \* Sy + Z2 \* Cy

As referred to in Claims 9 and 9a, the database is an internal list for storage of  
 285 events, variables, conditions and positions kept in standard computer random access  
 memory. The format for this information is kept in multiple sequential standard matrix  
 arrays. The data is accessed randomly as needed. The formats are double, matrix array  
 as shown below for all collected and gathered user data, variables and positions:

290 Position1(X,Y,Z,4,5,6,7,8)  
 Position2(X,Y,Z,4,5,6,7,8)  
 Position3(X,Y,Z,4,5,6,7,8)  
 Etc... to Nth Position  
 Position Nth(X,Y,Z,4,5,6,7,8)  
 295  
 VariableData1(Var1,Var2,Var3,Var4,Var5,Var6,Var7,Var8)  
 VariableData2(Var1,Var2,Var3,Var4,Var5,Var6,Var7,Var8)  
 VariableData3(Var1,Var2,Var3,Var4,Var5,Var6,Var7,Var8)  
 Etc... to Nth  
 300 VariableData Nth(Var1,Var2,Var3,Var4,Var5,Var6,Var7,Var8)  
  
 UserData1(User1,User2,User3,User4,User5,User6,User7,User8)  
 UserData2(User1,User2,User3,User4,User5,User6,User7,User8)  
 UserData3(User1,User2,User3,User4,User5,User6,User7,User8)  
 305 Etc... to Nth  
 UserData Nth(User1,User2,User3,User4,User5,User6,User7,User8)